



Muswellbrook Coal Company Limited

Spontaneous Combustion Report

For: Environmental Protection Licence 656

Reporting Period: February 2021

Authority Holder: Muswellbrook Coal Company Limited

Report Date: 17 March 2021

**Approved by: Brooke York
Environmental Superintendent**



Table of Contents

1.0 INTRODUCTION.....	1
2.0 SPONTANEOUS COMBUSTION MANAGEMENT MEASURES.....	1
3.0 GAS MONITORING RESULTS.....	4
4.0 RESPONSE TO ELEVATED GAS LEVELS	12
5.0 CORRELATION BETWEEN MANAGEMENT ACTIVITIES AND GAS LEVELS	12
6.0 CORRELATION BETWEEN COMMUNITY COMPLAINTS AND GAS LEVELS.....	12

List of Tables

Table 1: Spontaneous Combustion Management Measures	1
Table 2: Classification of Spontaneous Combustion Outbreaks.....	3
Table 3: Summary of Spontaneous Combustion	3
Table 4: Data Capture Rates	4

List of Figures

Figure 1: Location of Spontaneous Combustion Outbreaks in Open Cut 1.....	5
Figure 2: Location of Spontaneous Combustion Outbreaks in Open Cut 2.....	6
Figure 3: Hydrogen Sulphide 30 Minute Results	7
Figure 4: Sulphur Dioxide 1 Hour Results	8
Figure 5: Hydrogen Sulphide 1 Hour Results	9
Figure 6: Sulphur Dioxide 24 Hour Results	10
Figure 7: Hydrogen Sulphide 24 Hour Results	11



1.0 INTRODUCTION

The coal seams mined by the Muswellbrook Coal Company (MCC) operations are the Greta Coal Measures. These measures have a history of spontaneous combustion. Spontaneous combustion has been a long-term issue at MCC since the first operation commenced in 1907.

A Spontaneous Combustion Management Plan (SCMP) has been prepared according to the specific requirements of the Development Consent. The main objective of the SCMP is to minimise the occurrence of spontaneous combustion and manage the effect by identification, control, removal, mitigation and prevention in the following areas:

- Existing open cut and underground workings;
- Drilling and blasting;
- Mining of overburden;
- Mining of coal;
- Emplacement of overburden;
- Emplacement of washery reject; and
- Coal stockpiles.

The Environment Protection Authority (EPA) require MCC to provide reports on spontaneous combustion management and monitoring on a monthly basis. This report identifies:

- Spontaneous combustion management during the reporting period;
- Gas monitoring results;
- Number of complaints relating to spontaneous combustion;
- Response to hydrogen sulphide levels above the odour threshold; and
- Correlation between spontaneous combustion on site with gas results and complaints received.

2.0 SPONTANEOUS COMBUSTION MANAGEMENT MEASURES

The daily spontaneous combustion management measures for the reporting period are shown in **Table 1**.

Table 1: Spontaneous Combustion Management Measures

Date	Water Sprays	Water Carts Assisting	Capping	Hot Material Removal	Comments
01/02/21	-	S24/RL 195 DUMP	-	-	Wet Weather
02/02/21	-	-	-	S25	Wet Weather
03/02/21	-	S24/S25	-	S24/S25	
04/02/21	-	OC1	-	-	Wet Weather
05/02/21	-	OC1	-	-	
06/02/21	-	OC1	-	-	Wet Weather
07/02/21	-	OC1	-	-	Wet Weather
08/02/21	-	OC1	-	-	



Date	Water Sprays	Water Carts Assisting	Capping	Hot Material Removal	Comments
09/02/21	-	OC1	-	-	Wet Weather
10/02/21	-	S15	-	-	
11/02/21	-	OC1	-	-	
12/02/21	-	OC1	-	-	
13/02/21	-	OC1	-	-	Wet Weather
14/02/21	-	OC1	-	-	
15/02/21	-	OC1	-	-	Wet Weather
16/02/21	-	OC1	-	-	Wet Weather
17/02/21	-	OC1	-	-	Wet Weather
18/02/21	-	OC1	-	-	
19/02/21	-	OC1	-	-	
20/02/21	-	OC1	-	-	
21/02/21	-	OC1	-	-	Wet Weather
22/02/21	-	OC1	-	-	
23/02/21	-	OC1	-	-	
24/02/21	-	OC1	-	-	Wet Weather
25/02/21	-	OC1	-	-	
26/02/21	-	OC1	-	-	
27/02/21	-	S22	-	-	Wet Weather
28/02/21	-	OC1	-	-	

The classification system for spontaneous combustion outbreaks is provided in **Table 2**. A summary of the areas affected by spontaneous combustion and the areas controlled and treated during the reporting period is provided in **Table 3**. The locations of these areas can be seen in **Figure 1** to **Figure 2**.

**Table 2: Classification of Spontaneous Combustion Outbreaks**

Classification	Description
A	Open flame
B	Visible steam or smoke
C	Other physical evidence of spontaneous combustion (e.g. cracks, coal tars, sulphur crusting, etc)

* - classification revised in November 2019

Table 3: Summary of Spontaneous Combustion

Site Map Location	Classification (A-C)	Affected Area Without Active Control (m^2)	Active Controls Completed	Area Controlled (m^2)
Open Cut 1	A	0*	Mining	360**
	B	66*	Capping	0**
	C	22*	Infusion	0**
Open Cut 2	N/A	0*	None Required	0**
SUMMARY				
Total Area Affected		88*		
Total Area Controlled		360**		

* - at end of reporting period

** - during reporting period

No spontaneous combustion outbreaks were observed in Open Cut 2 throughout February 2021. Therefore, no active controls were implemented in Open Cut 2.

3.0 GAS MONITORING RESULTS

The gas monitoring results are displayed graphically in **Figure 3** to **Figure 7**. As noted in these graphs, there were no results above the health impact assessment criteria for the reporting period.

The data capture rates for the reporting period and the last 12 months are shown in **Table 4**.

Table 4: Data Capture Rates

Monitoring Location	Pollutant	Averaging Period	Data Capture – February (%)	Data Capture – 12 Month Rolling (%)
Point 9, Nisbet	Hydrogen Sulphide	30 minutes	94.9	91.8
		1 hour	93.9	90.7
		24 hours	100.0	95.1
Point 10, Muscle Creek	Hydrogen Sulphide	30 minutes	96.4	96.0
		1 hour	95.2	95.0
		24 hours	100.0	99.5
Point 15, Nisbet	Sulphur Dioxide	1 hour	95.5	91.3
		24 hours	100.0	95.3
Point 16, Muscle Creek	Sulphur Dioxide	1 hour	95.2	95.0
		24 hours	100.0	99.7

Data capture for all monitoring sites was 90% or higher during February 2021.

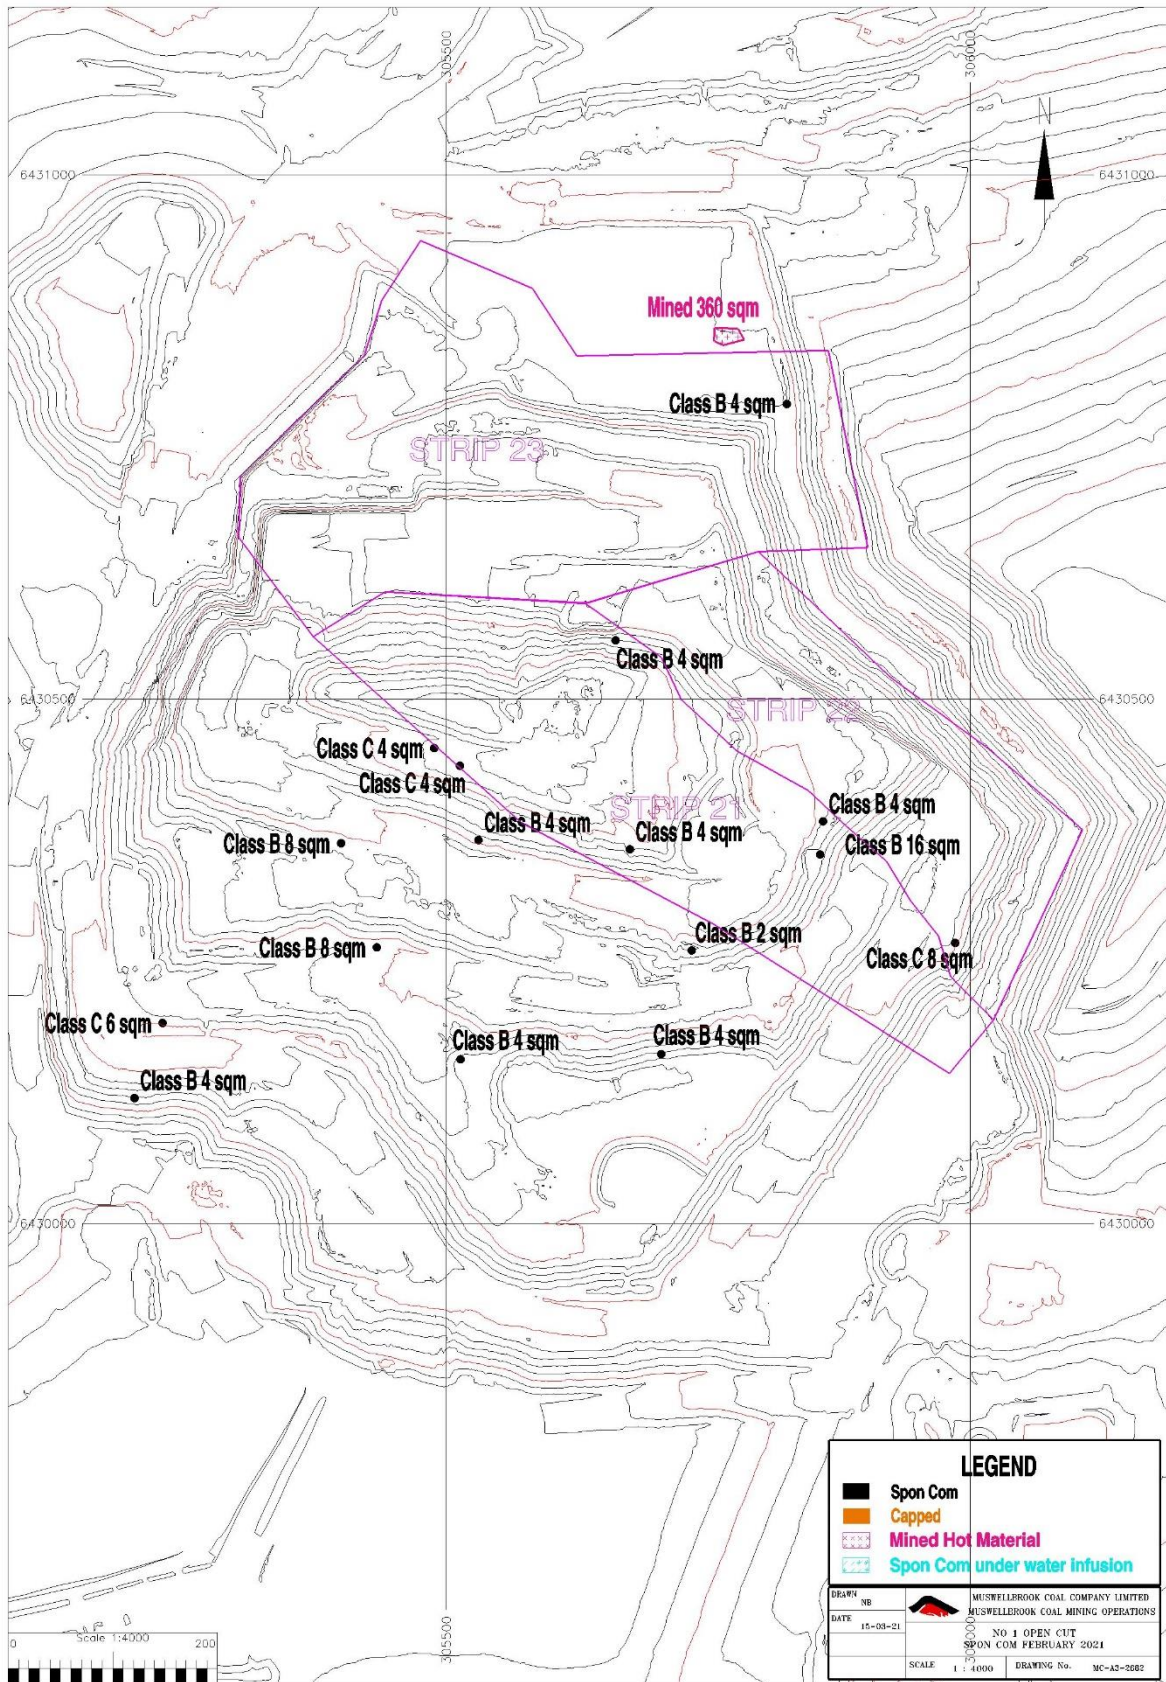


Figure 1: Location of Spontaneous Combustion Outbreaks in Open Cut 1

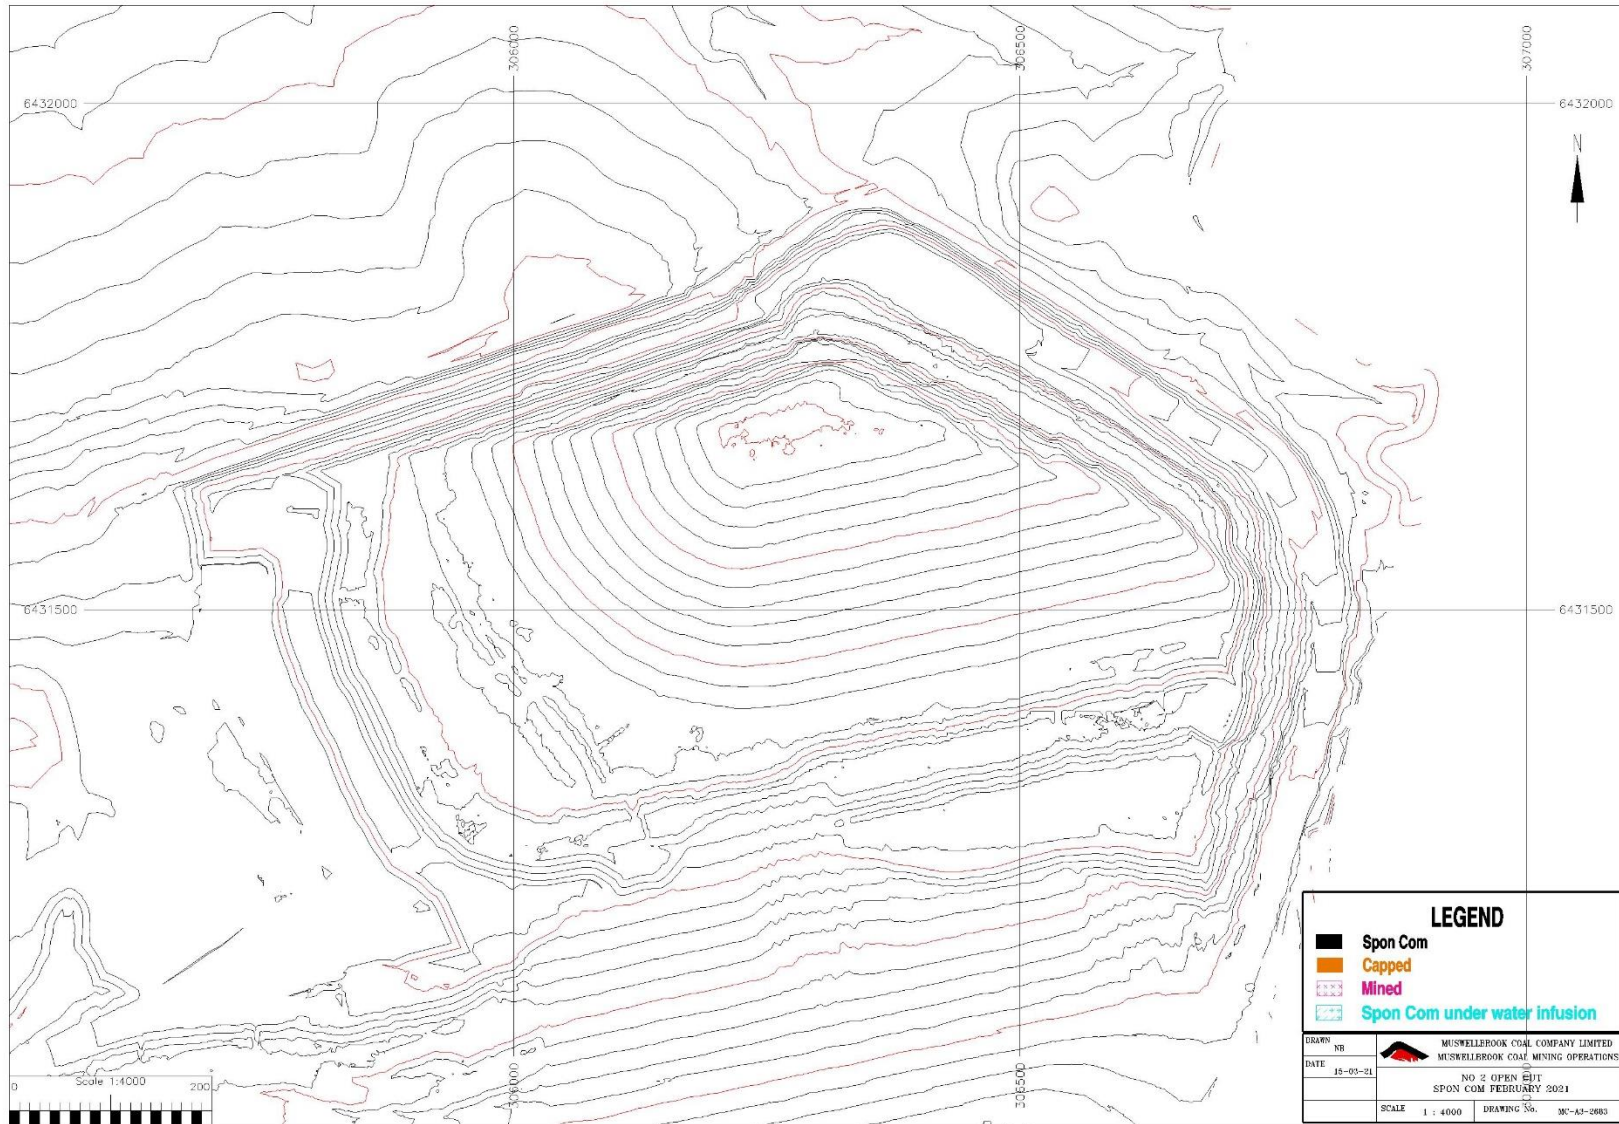


Figure 2: Location of Spontaneous Combustion Outbreaks in Open Cut 2

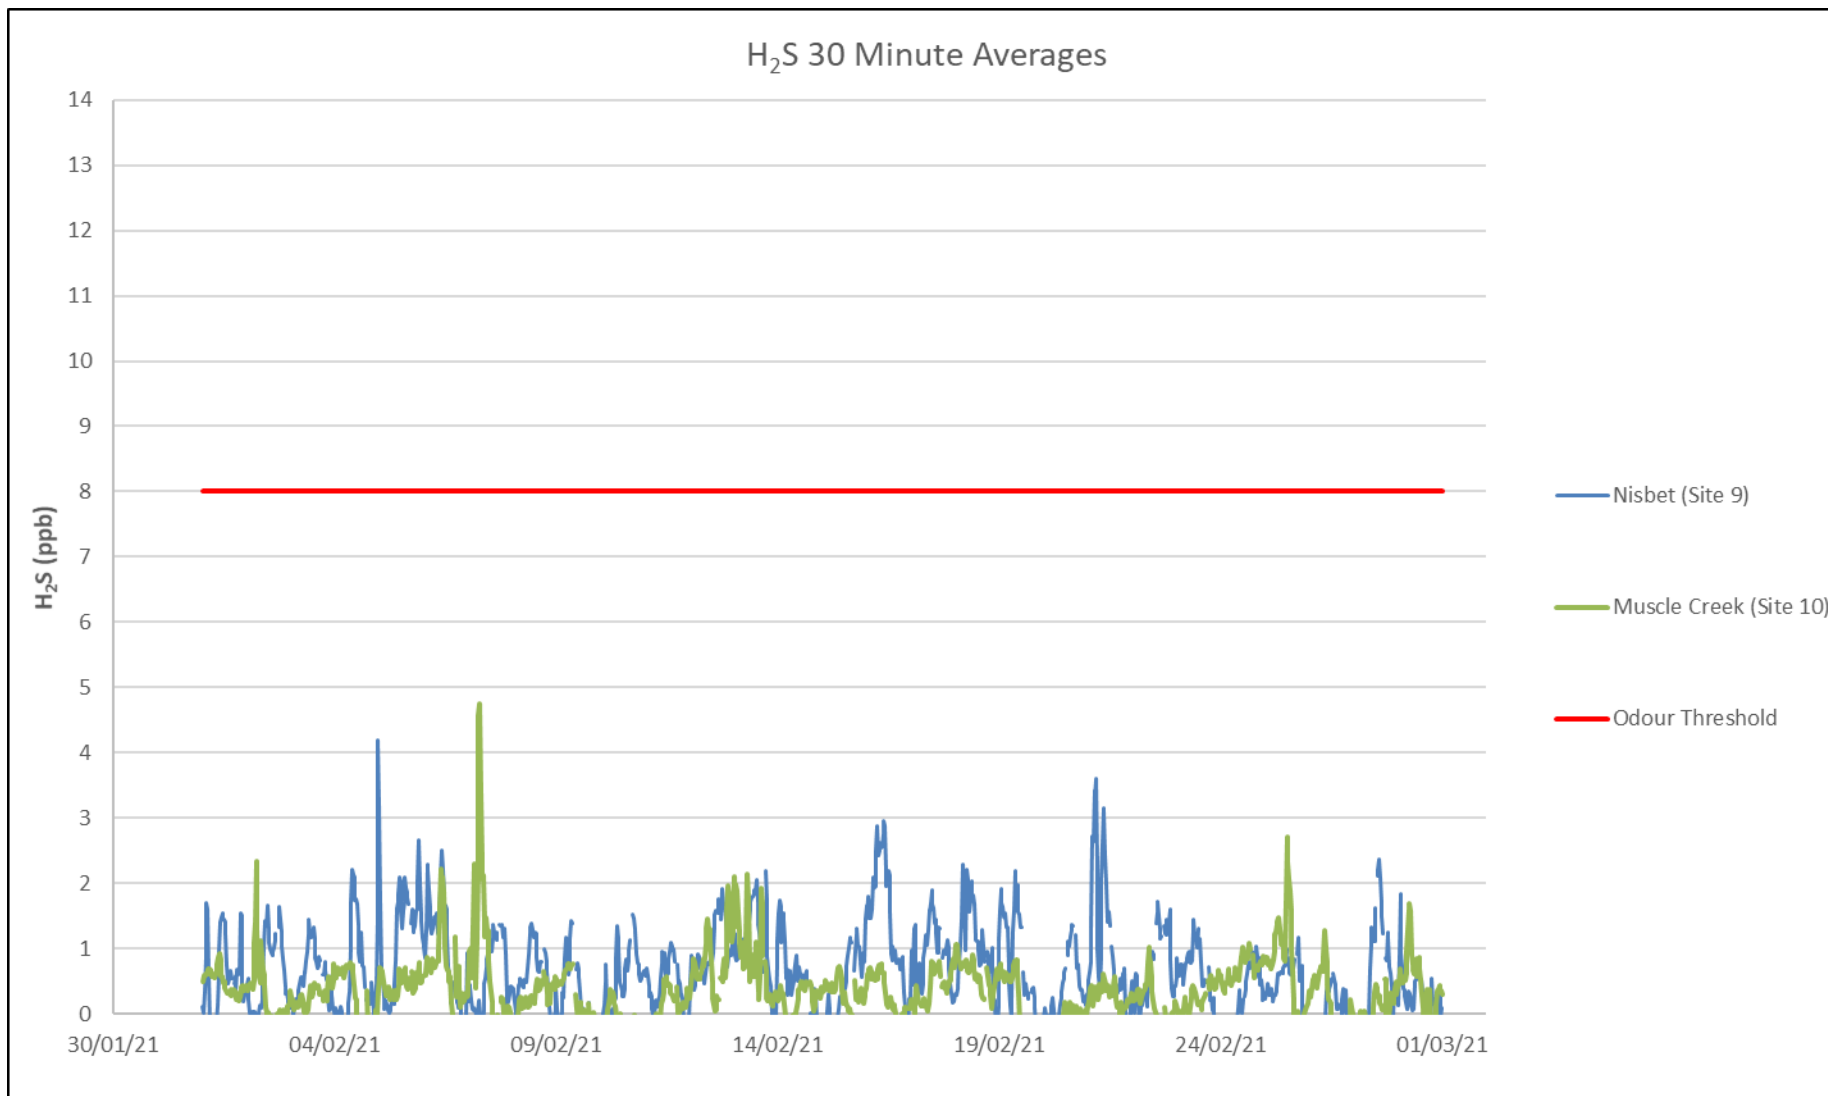


Figure 3: Hydrogen Sulphide 30 Minute Results

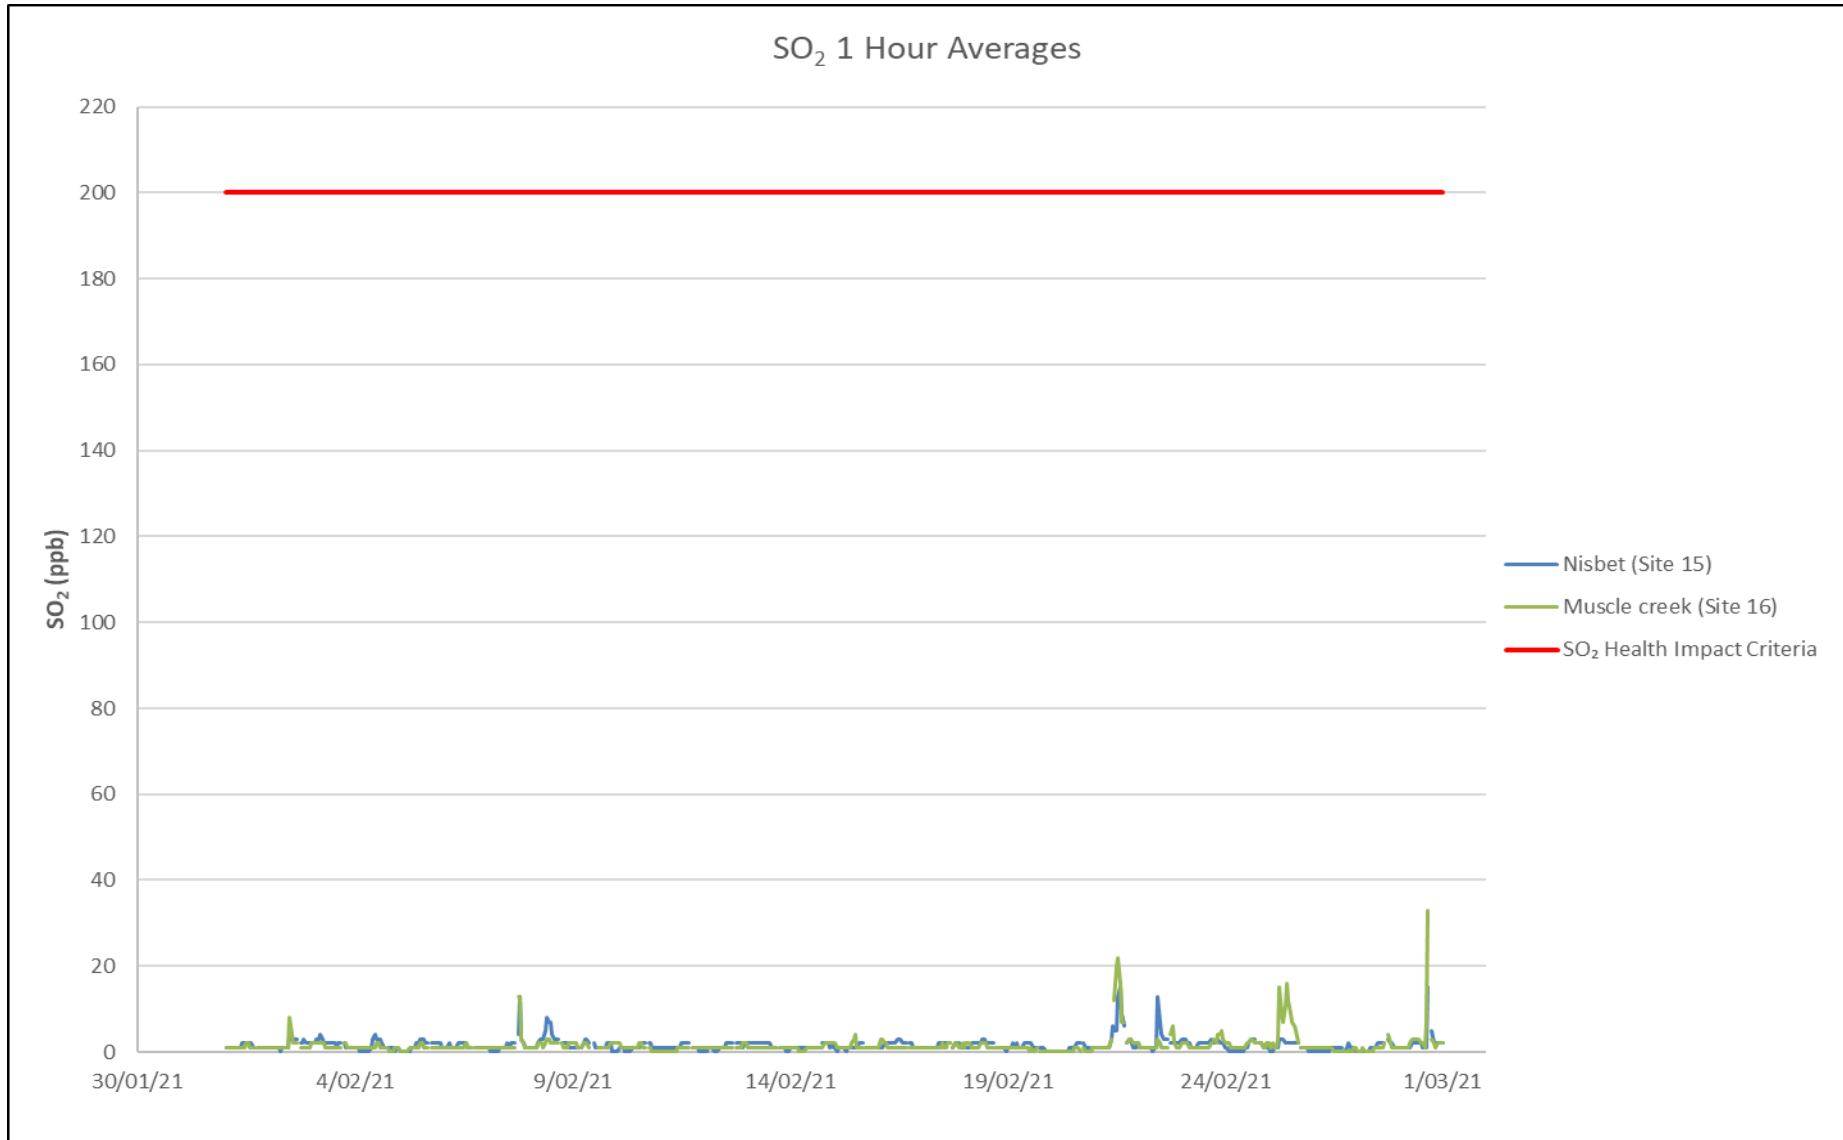


Figure 4: Sulphur Dioxide 1 Hour Results

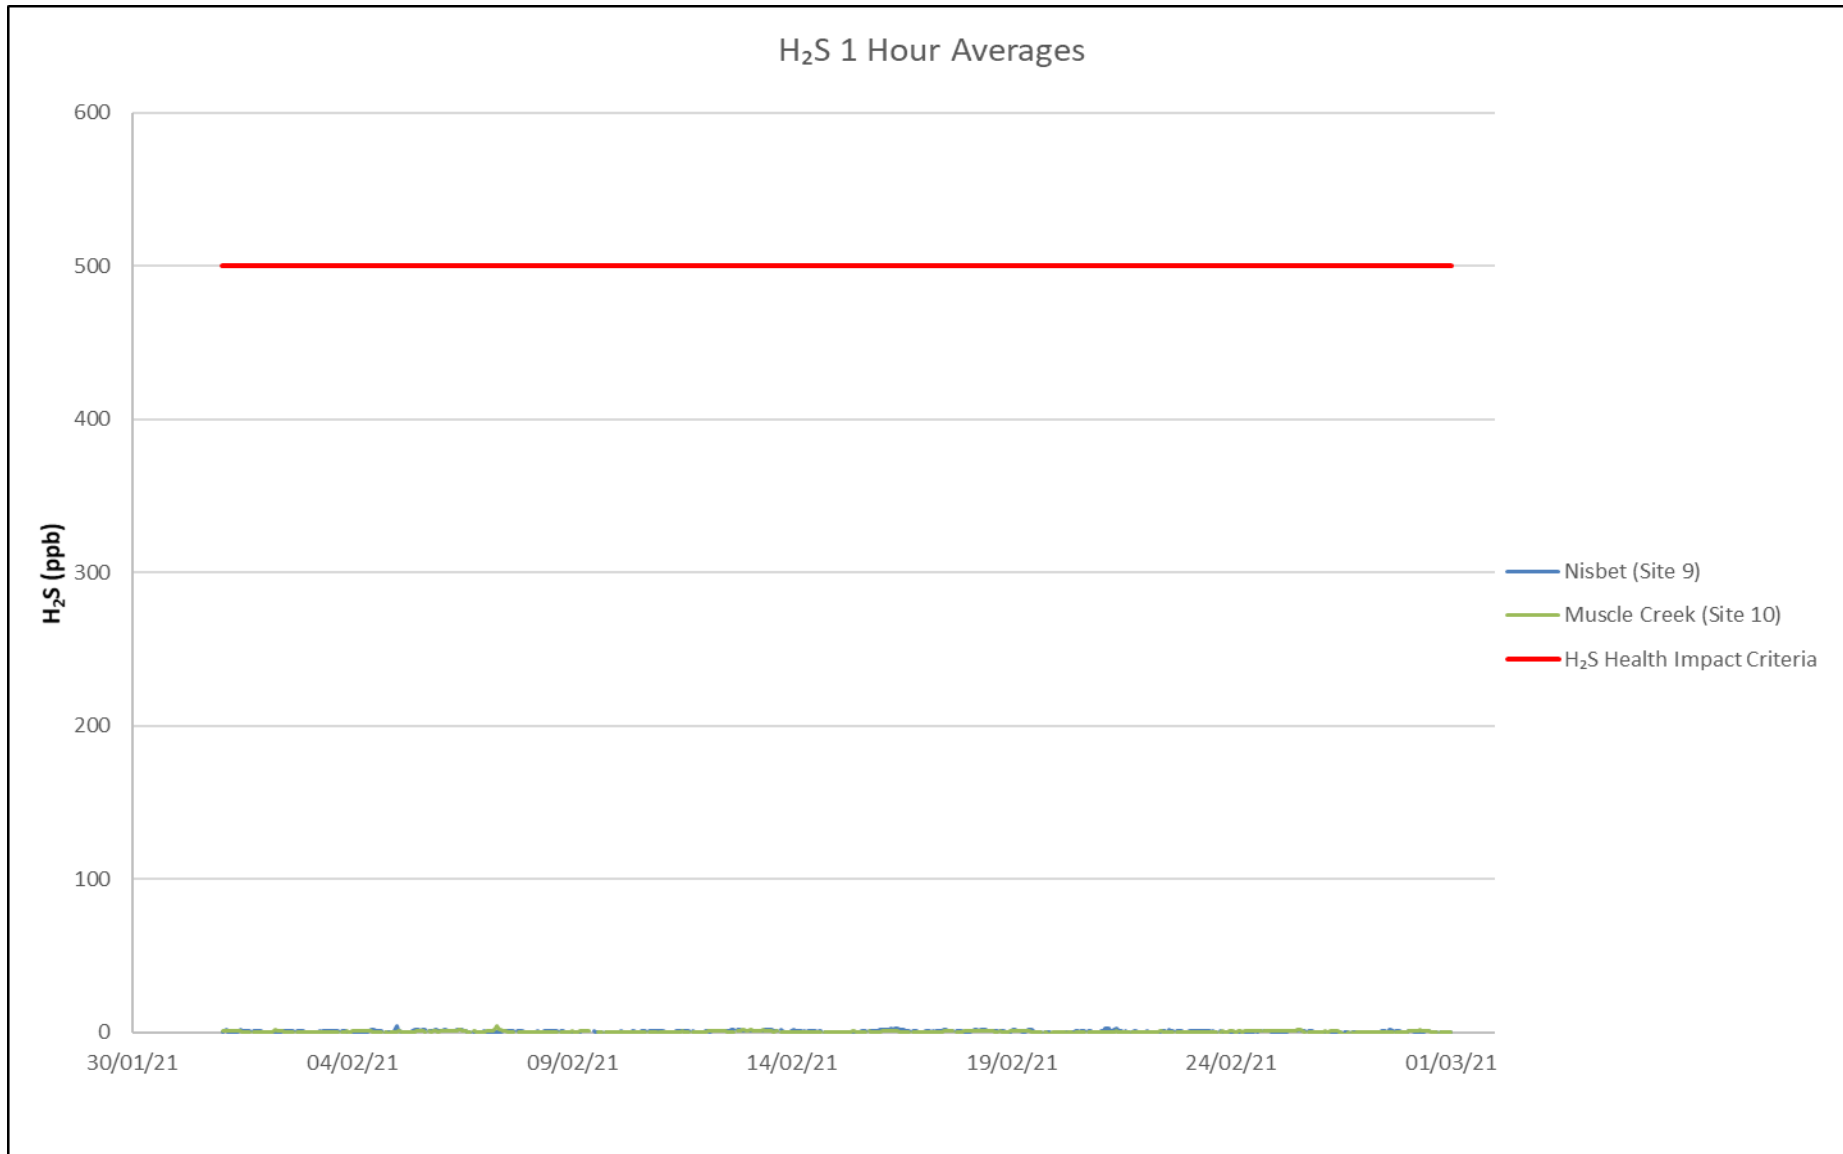


Figure 5: Hydrogen Sulphide 1 Hour Results

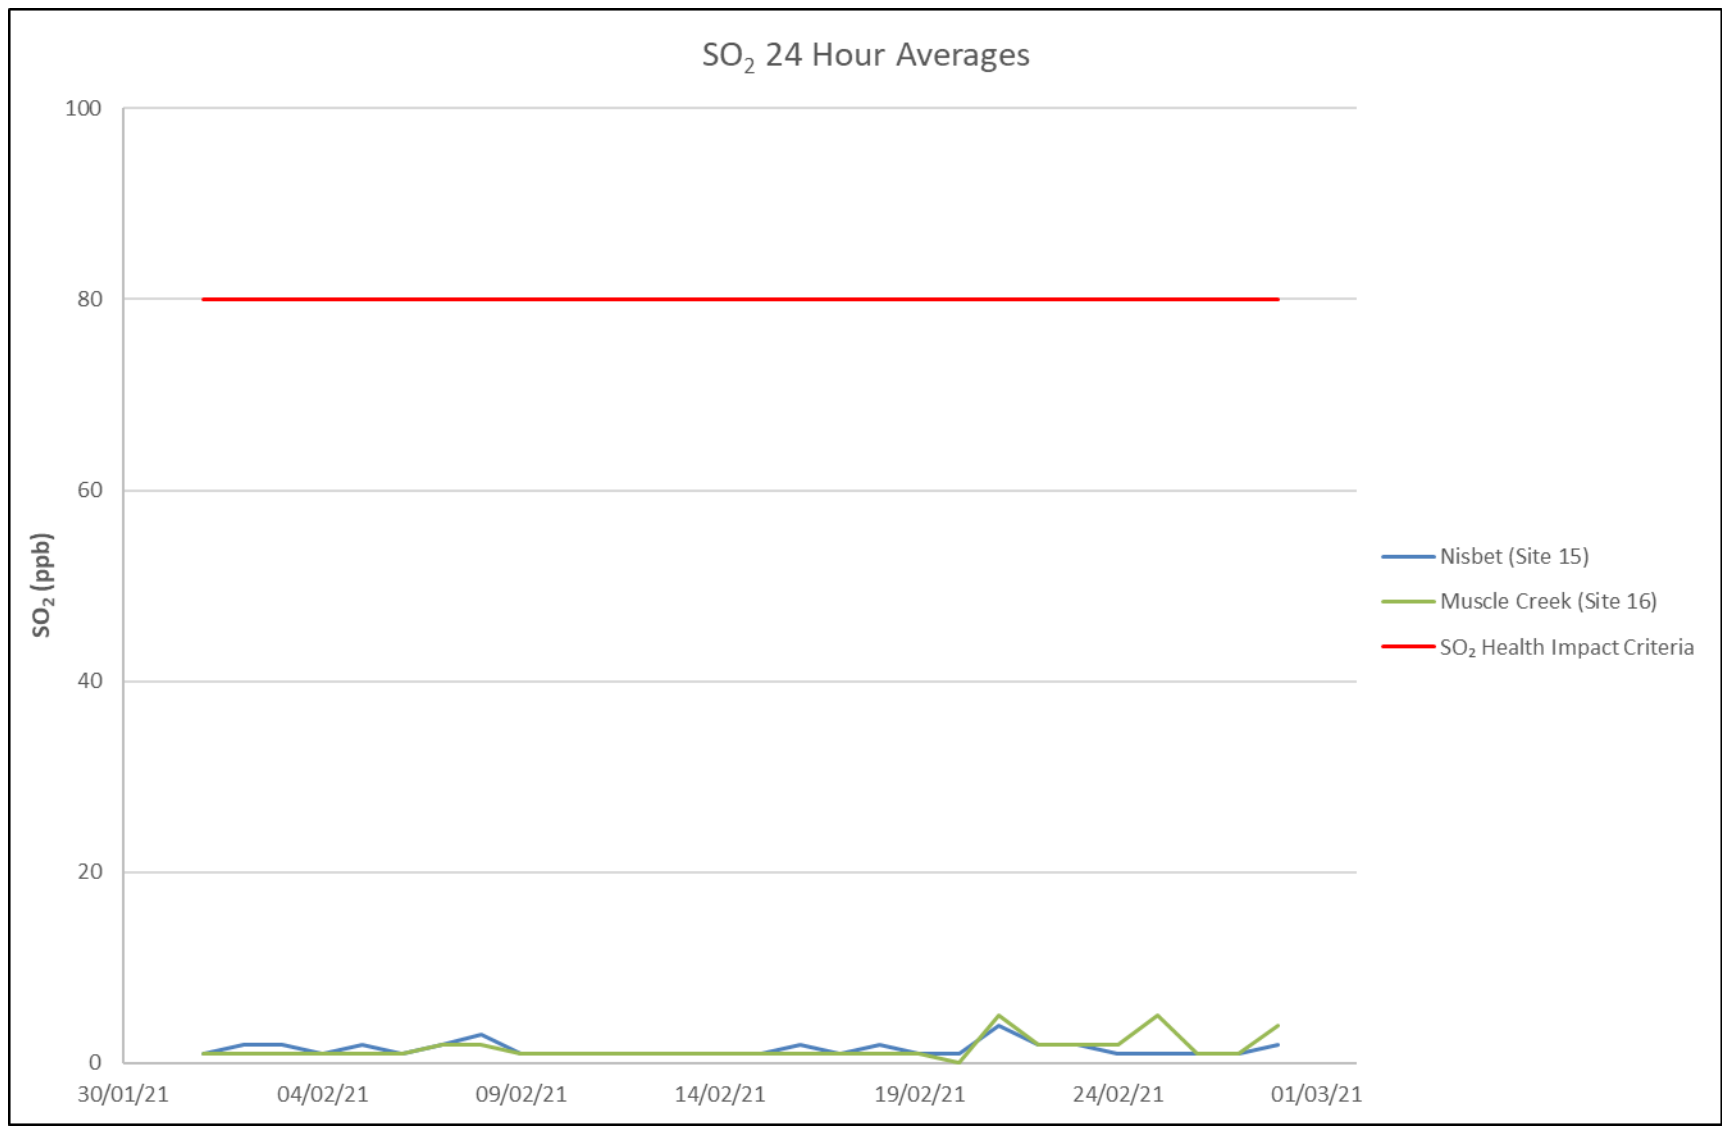


Figure 6: Sulphur Dioxide 24 Hour Results

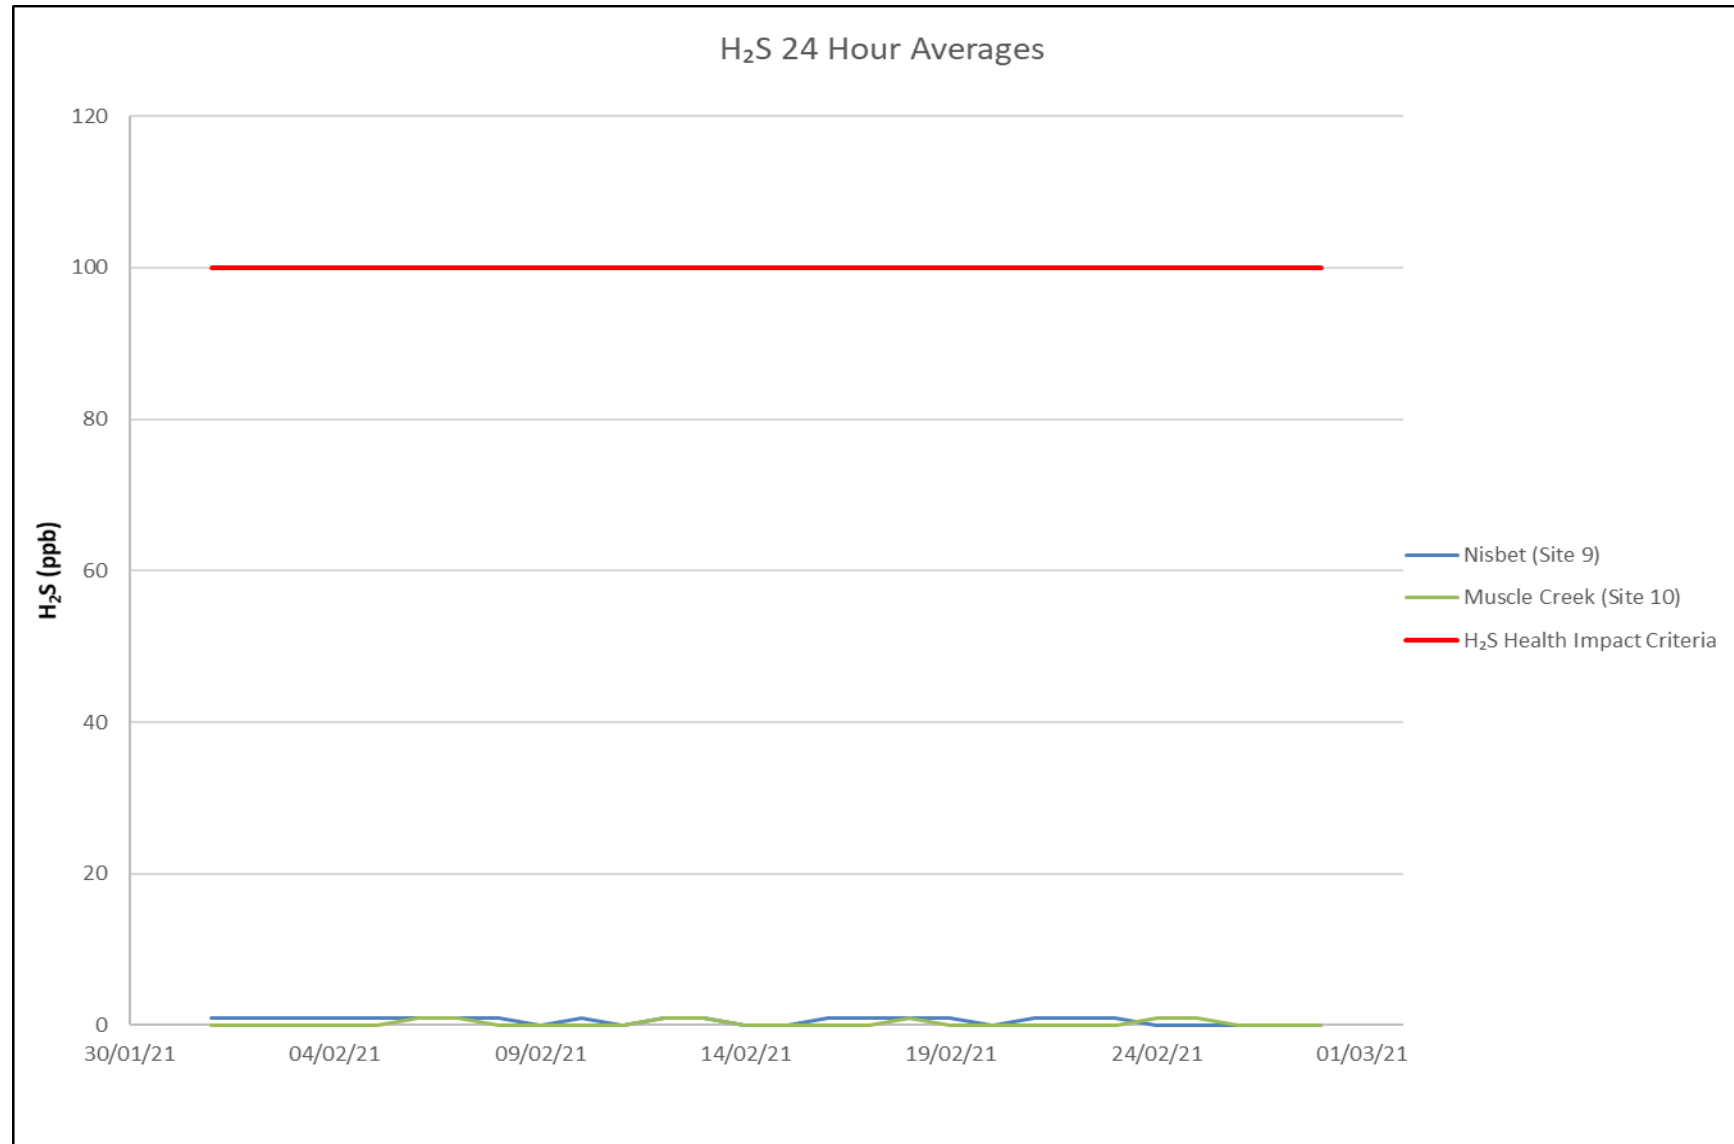


Figure 7: Hydrogen Sulphide 24 Hour Results



4.0 RESPONSE TO ELEVATED GAS LEVELS

When MCC receive an alarm that the hydrogen sulphide levels at the gas monitors are above the odour threshold of 8ppb, a review of operations and gas sources in the local area is undertaken. There were no alarms recorded for the reporting period in February 2021.

5.0 CORRELATION BETWEEN MANAGEMENT ACTIVITIES AND GAS LEVELS

A review of the correlation between spontaneous combustion management activities, gas levels and complaints has been undertaken. This review found that spontaneous combustion management activities were occurring throughout the reporting period and gas levels during the reporting period were generally low. All necessary prevention and management controls for spontaneous combustion were being undertaken to reduce spontaneous combustion emissions.

6.0 CORRELATION BETWEEN COMMUNITY COMPLAINTS AND GAS LEVELS

There were no complaints related to odour impacts from spontaneous combustion received during the reporting period.